

Date: Tuesday, 01/04/2008 3:46:27 PM
 User: Julie Lecocq

Process Sheet

Customer :	CU-DAR001 Dart Helicopters Services	Drawing Name :	SKIDTUBE ASSEMBLY
Job Number :	38280		
Estimate Number :	10022		
P.O. Number :		Part Number :	D205634011
This Issue :	01/04/2008	Drawing Number :	N/A
Prsht Rev. :	NC	Project Number :	N/A
First Issue :	//	Drawing Revision :	N/A
Previous Run :	38279	Material :	
Written By :		Due Date :	18/04/2008
Checked & Approved By :	<u>JO 08.4.01</u>	Qty:	1 Um: Each
Comment :	Est Rev:P 02.08.28 Removed QC5 from Step 5 KJ		

Additional Product

Job Number:



Seq. #:	Machine Or Operation:	Description :
----------------	------------------------------	----------------------

1.0	DC	DOCUMENT CONTROL
-----	----	------------------



Comment: DOCUMENT CONTROL

Photocopy bluefile & type labels per PPP D205-634-011

CHG005

08/04/23 08/4/17 SD

2.0	38280A	SKID TUBE ASSEMBLY
-----	--------	--------------------



Comment: Sub-Component SKID TUBE ASSEMBLY

D205-634-041 B 38280 A

SP

3.0	PACKAGING 1	PACKAGING RESOURCE #1
-----	-------------	-----------------------



Comment: PACKAGING RESOURCE #1

Pick Packing Kit

4.0	K10003	D205-634-011 Saddle Kit
-----	--------	-------------------------



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

Pick:

Qty	Part Number	Description	Batch
1	K10003	Saddle Kit	37901

5/4/23 SP

5.0	QC4	INSPECT 100% KITS FOR COMPLETENESS
-----	-----	------------------------------------



Comment: INSPECT 100% KITS FOR COMPLETENESS

08/04/23 (X)

B 38280A

W/O:		WORK ORDER CHANGES						
DATE	STEP	PROCEDURE CHANGE		By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Date: Tuesday, 01/04/2008 3:46:27 PM
User: Julie Lecocq

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: SKIDTUBE ASSEMBLY

Job Number: 38280

Part Number: D205634011

Job Number:



Seq. #:

Machine Or Operation:

Description :

6.0

PACKAGING 1

PACKAGING RESOURCE #1



(1X)

Comment: PACKAGING RESOURCE #1

Identify and pack for shipping as per PPP D205-634-011

Location: 2

8/4/23 SP

7.0

QC21

FINAL INSPECTION/W/O RELEASE



08/04/24 JA

Comment: FINAL INSPECTION/W/O RELEASE

Job Completion



u 08-04-24

W/O:		WORK ORDER CHANGES						
DATE	STEP	PROCEDURE CHANGE		By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Date: Tuesday, 01/04/2008 3:46:50 PM
User: Julie Lecocq

Process Sheet

Customer :	CU-DAR001 Dart Helicopters Services	Drawing Name :	SKID TUBE ASSEMBLY
Job Number :	38280A		
Estimate Number :	10023		
P.O. Number :		Part Number :	D205634041
This Issue :	01/04/2008	S.O. No. :	
Prsht Rev. :	NC	Drawing Number :	D2580 REV D
First Issue :	//	Project Number :	N/A
Previous Run :	38279A	Drawing Revision :	D
	Type :	Material :	
	LANDING GEAR	Due Date :	18/04/2008
Written By :		Qty:	1
Checked & Approved By :	JD 08.04.01	Um:	Each
Comment :	Est Rev:N 02.08.28 FP was QC5 in Step 27; Added QC5 to Step 30 KJ		
	Est Rev. O 06.02.28 Added paperwork EC		
	Est Rev:P 07-07-09 SS Wearplates & Gaskets JLM		

Additional Product

Job Number:



Seq. #:	Machine Or Operation:	Description :
---------	-----------------------	---------------

1.0	DC	DOCUMENT CONTROL
-----	----	------------------



Comment: DOCUMENT CONTROL NA JD 08.04.01
Photocopy D205-634 bluefile & type labels per PPP D205-634 CHG002

2.0	D25001190	Ext'n -I' Beam Tube 4"
-----	-----------	------------------------



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)
Pick:

Qty	Part Number	Description	Batch
1	D2500-1-190	Skid Tube Extrusion	B34729

JD 8-4-8

3.0	D2596	205 Web
-----	-------	---------



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)
Pick:

Qty	Part Number	Description	Batch
1	D2596	205 Web	38294

ET 08-04-12

4.0	SKIDTUBES 1	SKIDTUBESS RESOURCE 1
-----	-------------	-----------------------



Comment: LANDING GEAR RESOURCE 1

- 1- Inspect mat'l D2500-1-190 for damage
- 2-Cut D2500-1-190 per Dwg D2580 if necessaryDeburr ends
- 3-Acid etch and Alodine tube per QSI 005 4.1

JD 8-4-8

W/O:		WORK ORDER CHANGES						
DATE	STEP	PROCEDURE CHANGE		By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Date: Tuesday, 01/04/2008 3:46:50 PM
User: Julie Lecocq

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: SKID TUBE ASSEMBLY

Job Number: 38280A

Part Number: D205634041

Job Number:



Seq. #:

Machine Or Operation:

Description :

5.0

QC3

INSPECT POWDER COAT/CHEMICAL CONVERSION



Comment: INSPECT POWDER COAT/CHEMICAL CONVERSION

RT 08-04-10

6.0

SKIDTUBES 1

SKIDTUBESS RESOURCE 1



Comment: LANDING GEAR RESOURCE 1

1-Drill pilot holes using drill jig DT 8149(Do not use cutting fluid)

2-Open holes to 0.500" as per Dwg D2580without cutting fluid

3-Countersink holes as per Dwg D2580without cutting fluid

4-Deburr and blow out all chips from inside of tube

5-Bond web in place per QSI 015. Allow 12 Hrs. cure time before cutting

Pick:

Qty	Part Number	Description	Batch
A/R	Sikaflex-291	102397	

Sikaflex expire date: 08-10-01

Start Time: 11:30 Date: 08-04-12

Fin Time: 7:00 Date: 8-4-14

RT 08-04-12

JB

7.0

BENDING

BENDING MACHINE : SKIDTUBES



Comment: BENDING MACHINE

1-Bend as per program D2580.C on CNC Bender and Folio FT009

2-Cut tubes as per Dwg. D2580

FL JB 8-4-14

8.0

SKIDTUBES 1

SKIDTUBESS RESOURCE 1



Comment: LANDING GEAR RESOURCE 1

1-Deburr ends

2-Prepare tube for welding, remove alodine as required.

RT 08-04-15

W/O:		WORK ORDER CHANGES						
DATE	STEP	PROCEDURE CHANGE		By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Date: Tuesday, 01/04/2008 3:46:50 PM
User: Julie Lecocq

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: SKID TUBE ASSEMBLY

Job Number: 38280A

Part Number: D205634041

Job Number:



Seq. #:

Machine Or Operation:

Description :

9.0

QC5

INSPECT WORK TO CURRENT STEP



Comment: INSPECT WORK TO CURRENT STEP

06/04/15 (x)

10.0

D25763

Step (Machining Detail)



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

Pick:

Qty	Part Number	Description	Batch
1	D2576-3	Step	33321

BE 08/04/17

11.0

D2579

Crossbolt Spacer



Comment: Qty.: 20.0000 Each(s)/Unit Total : 20.0000 Each(s)

Pick:

Qty	Part Number	Description	Batch
20	D2579	Spacers	237752

BE 08/04/17

12.0

LARGE FAB 1

LARGE FABRICATION RESOURCE 1



Comment: LARGE FABRICATION RESOURCE 1

2-Weld step D2576 as per Dwg. D2580 and QSI 004

A/R Aluminum Rod

M107263 BE 08/04/17

3-Weld crossbolt spacers D2579 as per Dwg. D2580 and QSI 004.

For D2579 spacers, weld one side, pass 3/8" drill, weld other side, pass 3/8" drill

A/R Aluminum Rod

M107263 BE 08/04/17

4-Grind welds as per Dwg D2580 Grind flush ridge made from bending

5-Drill holes for wearplates using DT 8217 & DT8937 Open holes to 19/64", adjust stopper not to hit web. Debur

6-Counterbore crossbolt spacers to 7/16" ID x 1.0" deep as per Dwg D2580. Debur holes

7-Drill pilot holes for aft cap using DT 8215 Open holes to 0.208". Debur

8-Drill pilot holes for Tow ring using DT8091, open to .640" and Debur

SL 8-4-18

W/O:		WORK ORDER CHANGES						
DATE	STEP	PROCEDURE CHANGE		By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Date: Tuesday, 01/04/2008 3:46:50 PM
User: Julie Lecocq

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: SKID TUBE ASSEMBLY

Job Number: 38280A

Part Number: D205634041

Job Number:



Seq. #:

Machine Or Operation:

Description :

13.0

QC10

VISUAL INSPECTION OF GROUND WELDS



Comment: VISUAL INSPECTION OF GROUND WELDS

08/04/19 (X)

14.0

QC5

INSPECT WORK TO CURRENT STEP



Comment: INSPECT WORK TO CURRENT STEP

08/04/19 (X)

15.0

HAND FINISHING1

HAND FINISHING RESOURCE #1



Comment: HAND FINISHING RESOURCE #1
Pressure wash as per QSI 005

08-04-21

16.0

POWDER COATING

POWDER COATING



Comment: POWDER COATING
Powder Coat White Gloss (Ref: 4.3.5.1) as per QSI 005 4.3.

M107550

08/04/21

17.0

QC3

INSPECT POWDER COAT/CHEMICAL CONVERSION



Comment: INSPECT POWDER COAT/CHEMICAL CONVERSION

08-04-22 (X)

18.0

D2855

Cap



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)
Cap
Batch: 1337570

08/04/21

19.0

AN35A

Bolt



Comment: Qty.: 2.0000 Each(s)/Unit Total : 2.0000 Each(s)
Bolt
Batch: M100188

08/04/21

20.0

AN960JD10L

Washer



Comment: Qty.: 2.0000 Each(s)/Unit Total : 2.0000 Each(s)
Washer
Batch: M1104885

08/04/21

08-04-22 (X)

301
S.076 22/008
#1
#2 3382A
#3
#4 02056341

W/O:		WORK ORDER CHANGES						
DATE	STEP	PROCEDURE CHANGE		By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Date: Tuesday, 01/04/2008 3:46:50 PM
User: Julie Lecocq

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: SKID TUBE ASSEMBLY

Job Number: 38280A

Part Number: D205634041

Job Number:



Seq. #:	Machine Or Operation:	Description :
---------	-----------------------	---------------

21.0	ALS71032130	Insert
------	-------------	--------



Comment: Qty.: 50.0000 Each(s)/Unit Total : 50.0000 Each(s)

Insert

Batch: M 105 855

HL

22.0	AN3C4A	BOLT
------	--------	------



Comment: Qty.: 50.0000 Each(s)/Unit Total : 50.0000 Each(s)

BOLT

Batch: M 110 7736

HL

23.0	AN960C10L	washer
------	-----------	--------



Comment: Qty.: 50.0000 Each(s)/Unit Total : 50.0000 Each(s)

washer

Batch: M 107 376

HL

24.0	D356613	GASKET
------	---------	--------



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

GASKET

Batch: B32744

HL

25.0	D35665	GASKET
------	--------	--------



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

GASKET

Batch: B38218

HL

26.0	D35661	GASKET
------	--------	--------



Comment: Qty.: 2.0000 Each(s)/Unit Total : 2.0000 Each(s)

GASKET

Batch: B38410

HL

27.0	D356413	WEARSHOE
------	---------	----------



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

WEARSHOE

Batch: B38047

HL

08-04-22 (VI)

W/O:		WORK ORDER CHANGES						
DATE	STEP	PROCEDURE CHANGE		By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Date: Tuesday, 01/04/2008 3:46:50 PM
User: Julie Lécocq

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: SKID TUBE ASSEMBLY

Job Number: 38280A

Part Number: D205634041

Job Number:



Seq. #:

Machine Or Operation:

Description :

28.0

D356411

WEARSHOE



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

WEARSHOE

Batch: B37811

JSR

29.0

D35649

WEARSHOE



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

WEARSHOE

Batch: B37812

JSR

30.0

D35645

WEARSHOE



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

WEARSHOE

Batch: B38297

JSR

31.0

D25943

O-Ring



Comment: Qty.: 16.0000 Each(s)/Unit Total : 16.0000 Each(s)

O-Ring

Batch: B29908

JSR

32.0

D25941

Plug



Comment: Qty.: 16.0000 Each(s)/Unit Total : 16.0000 Each(s)

Plug

Batch: B37926

JSR

33.0

HAND FINISHING1

HAND FINISHING RESOURCE #1



Comment: HAND FINISHING RESOURCE #1

1-Install inserts & wearplates & Gaskets as per Dwg. D2580. Use a drop of Sikaflex on insert holes before installing wearplates

A/R Sikaflex-291 M107804

Sikaflex expire date: 08/10

2-Coat D2594-3 O' rings with Petroleum Jelly and install on D2594-1 plugs as per Dwg D2580

3-Inspect for foreign object per QSI 024

JSR

08-04-22

JSR

W/O:		WORK ORDER CHANGES						
DATE	STEP	PROCEDURE CHANGE		By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Date: Tuesday, 01/04/2008 3:46:50 PM
User: Julie Lecocq

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: SKID TUBE ASSEMBLY

Job Number: 38280A

Part Number: D205634041

Job Number:



Seq. #:

Machine Or Operation:

Description :

4-Install 2855 Aft Cap as per Dwg D2580 and seal Fwd Step & Aft Cap with Sikaflex. Clean excess adhesive

A/R Sikaflex-291 M107804 > 08-04-22 (X)
Sikaflex expire date: 08/10

5-Wing Walk as per Dwg D2580 and QSI 005 4.4

Batch: M106894 m.f. 08/04/22 (1X)

34.0

QC5

INSPECT WORK TO CURRENT STEP



08/04/23 (K)



Comment: Inspect Aft Cap, Fwd Step and Wing Walk of work to Current Step Inspect for Foreign objects per QSI 024

35.0

PACKAGING 1

PACKAGING RESOURCE #1



(K)

Comment: PACKAGING RESOURCE #1

Identify and pack for shipping as per PPP D205-634-041

Location:

PPP Rev: 38280

8/4/23

SP

36.0

QC21

FINAL INSPECTION/W/O RELEASE



08/04/24 (K)

Comment: FINAL INSPECTION/W/O RELEASE

Job Completion



mf 08-04-23

W/O:		WORK ORDER CHANGES						
DATE	STEP	PROCEDURE CHANGE		By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries



DESIGN <i>[Signature]</i>	DRAWN BY <i>[Signature]</i>	DART AEROSPACE LTD HAWKESBURY, ONTARIO, CANADA	
CHECKED <i>[Signature]</i>	APPROVED <i>[Signature]</i>	DRAWING NO. D2580	REV. D SHEET 1 OF 3
DATE 07.02.27		TITLE 205 SKIDTUBE ASSEMBLY	SCALE NTS
A	96.09.16	NEW ISSUE	
B	96.12.02	AS MANUFACTURED	
C	98.08.26	REDRAWN, INCLUDED DEO 9094/9097	
D	07.02.27	CHANGE TO SS WEARPLATES AND GASKETS, INCLUDE DEO 9124/9183	

RELEASED
07-06-28 #

QTY -041	QTY -045	Part Number	Description
X		D2580-041	SKIDTUBE ASSEMBLY
	X	D2580-045	SKIDTUBE ASSEMBLY
1	1	D2500-1-190	EXTRUSION
1	1	D2576-3	STEP
20	24	D2579	CROSS BOLT SPACER
16	16	D2594-1	PLUG
16	16	D2594-3	O-RING
1	1	D2596	205 WEB
1	1	D2855	AFT CAP
1	1	D3564-5	WEARSHOE
1	1	D3564-9	WEARSHOE
1	1	D3564-11	WEARSHOE
1	1	D3564-13	WEARSHOE
2	2	D3566-1	GASKET
1	1	D3566-5	GASKET
1	1	D3566-13	GASKET
50	50	ALS7-1032-130 or AKS7-1032-130 or AKS4-1032-130 or AELS-1032-130	INSERT
50	50	AN3C4A	BOLT
2	2	AN3-5A	BOLT
50	50	AN960C10L	WASHER
2	2	AN960JD10L	WASHER

GENERAL NOTES:

- 1) TOLERANCES ARE PER DART QSI 018 UNLESS OTHERWISE NOTED
- 2) ALL DIMENSIONS ARE IN INCHES
- 3) INSERT D2596 WEB TO LOCATION SHOWN OFF AFT END OF SKIDTUBE AND BOND WEB INTO OUTER TUBE WITH NON-STRUCTURAL SIKAFLEX-241 ADHESIVE PER DART QSI 015 BEFORE BENDING. ENSURE HOLES LINE-UP.
- 4) BEND AS A SMOOTH RADIUS STARTING WITH A MAXIMUM CENTERLINE RADIUS OF 60 AND ENDING WITH A MINIMUM RADIUS OF 30. A MAXIMUM REDUCTION OF 0.200 IN DIAMETER IS ALLOWABLE IN THE BENT PORTION OF THE TUBE.
- 5) USE DART DRILL TEMPLATE TD2577-205 TO LOCATE AND DRILL Ø0.297 HOLES FOR WEARSHOE INSERTS. INSTALL ALS7-1032-130 PER SECTION D-D (50 PLACES) AFTER FINISH. INSTALL AN3C4A BOLTS AND AN960C10L WASHERS WITH SIKAFLEX-241/-291.
- 6) WELDING TO BE DONE PER DART QSI 004.
- 7) FINISH:
SEE NOTES ON
PAGE 2 FOR D2580-041 AND
PAGE 3 FOR D2580-045
- 8) INSERT D2594-1 PLUG C/W D2594-3 O-RING IN HOLES MARKED 'P' (BOTH SIDES OF TUBE) AFTER FINISH (16 PLACES).

SHOP COPY
RETURN TO
ENGINEERING
UNCONTROLLED COPY
SUBJECT TO AMENDMENT
WITHOUT NOTICE
WORK ORDER
NO. 382807

Copyright © 1996 by DART AEROSPACE LTD

THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.

RELEASED
07-06-28

Diagram illustrating the grinding locations for the D2576-3 step. The diagram shows a cross-section of the step with the following labels:

- GRIND FLUSH (4 PLACES)
- GRIND FLUSH
- D2576-3 STEP
- GRIND FLUSH
- LOCATION RIDGE ON UNDERSIDE OF D2576

#0.208
DRILL PRIOR TO D2855 CAP
INSTALLATION (2 PLACES)

AN3-5A BOLT (1)
AN960JDTOL WASHER (1)
(2 PLACES)

D2855 CAP

SEAL WITH
SIKAFLEX-241/-291

UN
su
0.40

Diagram illustrating the components of a circular web assembly:

- D2579 SPACER
- D2596 WEB (REF)
- 7-1032-130 (REF) (TYP 50 PLACES)
- AFTER PERFORM
- 1. CHA
- 2. INS
- 3. WE
- 4. C'B

AFTER DRILLING AND BENDING ASSEMBLY
PERFORM THE FOLLOWING FOR #0.508 HOLES ONLY:

1. CHAMFER HOLE 0.050 X 45°
2. INSERT D2579 SPACER (20 PLACES)
3. WELD INTO PLACE AND GRIND FLUSH
4. C'BORE D2579 SPACER TO $\phi 0.437$ X 1.00 DEEP

i) FINISH: ACID ETCH, ALODINE PER DART QSI 005 4.1 PRIOR TO INSERTING D2596 WEB POWDER COAT ASSEMBLY GLOSS WHITE (REF. 4.3.5.1) PER DART QSI 005 4.3 BLACK ANTI-SKID PAINT AS INDICATED PER DART QSI 005 4.4

[illegible]

Figure 1 is a cross-sectional diagram of a road. The total width of the road is 10.640 m. On the left side, there is a shoulder of 1.4 m. The road surface is 1.0 m wide. The distance between the hole and the tangent point is 1.0 m. The road is shown with a dashed centerline and a solid edge line. The road is labeled with a '4' in a triangle, indicating a 4% slope. The road is shown with a 1.0 m distance between the hole and the tangent point. The road is shown with a 1.0 m distance between the hole and the tangent point.

0.5 1.5 1.5 0.8 1.5 1.5 1.5

BLACK ANTI-SKID TO 0.5 ABOVE LOCATION RIDGE

BLACK ANTI-SKID TOP OF STEP TO 0.5 ABOVE BOTTOM EDGE

WELD AS PER DETAIL B

8

P P P P P P P P

REFER TO DETAIL C

D3566-1 D3566-5 D3566-1 D3566-13

D3564-11 D3564-5 D3564-9 D3564-13

AN3C4A BOLT (1)
AN960C10L WASHER (1)
(50 PLACES)

DESIGN J DRAWN BY


COPYRIGHT © 1996 BY DART AEROSPACE LTD.

THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL
AND IS SUPPLIED ON THE EXPRESS CONDITION
THAT IT IS NOT TO BE USED FOR ANY PURPOSE
OR COPIED OR COMMUNICATED TO ANY OTHER
PERSON WITHOUT WRITTEN PERMISSION FROM
DART AEROSPACE LTD.

DESIGN	<i>[Signature]</i>	DRAWN BY	<i>[Signature]</i>
CHECKED	<i>[Signature]</i>	APPROVED	<i>[Signature]</i>
DATE			
07.02.27			

DART DART AEROSPACE LTD.
HAWKESBURY, ONTARIO, CANADA

DRAWING NO.	REV. D
D2580	SHEET 2 OF 3
TITLE	SCALE
205 SKIDTUBE ASSEMBLY	1:24

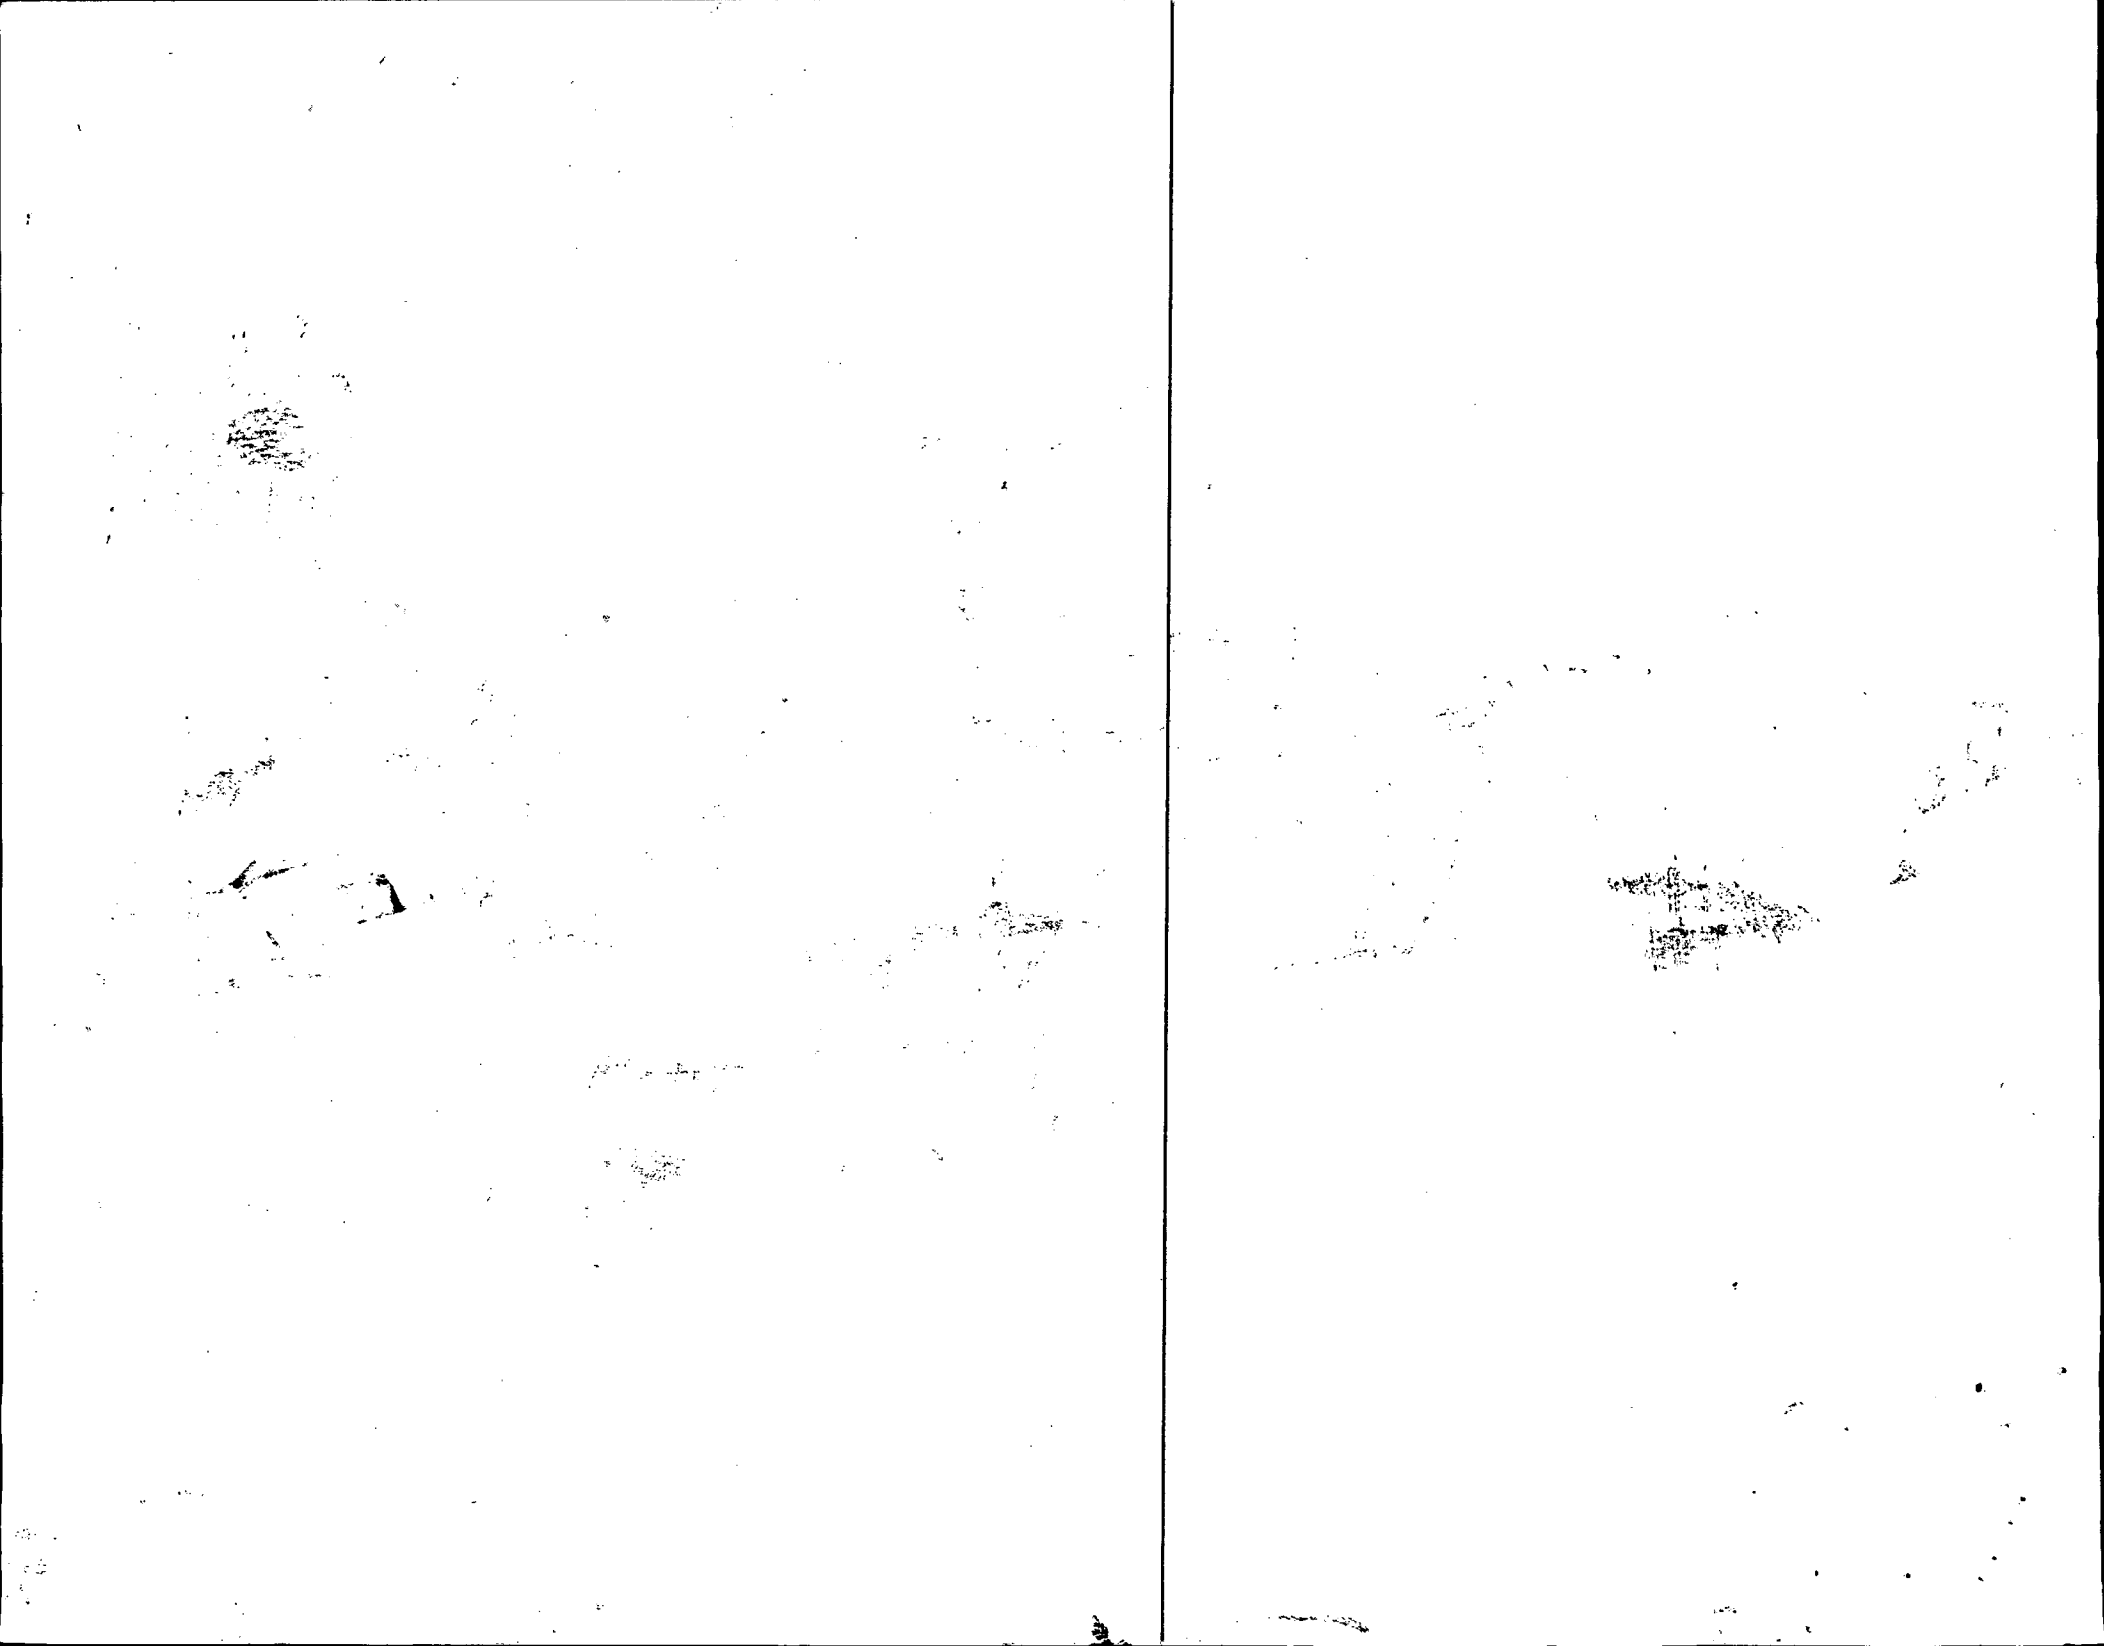

RELEASED
07-06-28

Diagram illustrating the underside of the component, showing the location of the ridge on the underside of D2576. The diagram includes labels for the GRIND FLUSH (4 PLACES), GRIND FLUSH, D2576-3 STEP, and LOCATION RIDGE ON UNDERSIDE OF D2576.

Technical drawing of a circular component, likely a cap or cover, showing various fasteners and labels. The drawing includes the following labels and dimensions:

- DRILL PRIOR TO D2855 CAP INSTALLATION (2 PLACES)
- SEAL WITH SIKAFLEX-241/-291
- AN3-SA BOLT (1)
- AN960JD10L WASHER (1)
- (2 PLACES)
- D2855 CAP
- SEE NOTE ii)
- 0.40

Diagram illustrating the structure of a circular web with a cross-section. Labels include:

- D2579 SPACER
- WEB (REF)
- 130 (REF)
- 0 PLACES

PERFORATION DETAILS:

1. CHA
2. INS
3. WE
4. C'B

- AFTER DRILLING AND BENDING ASSEMBLY
PERFORM THE FOLLOWING FOR Ø0.508 HOLES ONLY:
1. CHAMFER HOLE 0.050 X 45°
 2. INSERT D2579 SPACER (20 PLACES)
 3. WELD INTO PLACE AND GRIND FLUSH
 4. C'BORE D2579 SPACER TO Ø0.437 X 1.00 DEEP

i) FINISH: ACID ETCH, ALODINE PER DART QSI 005 4.1 PRIOR TO INSERTING D2596 WEB POWDER COAT ENTIRE ASSEMBLY GREEN (REF. 4.3.5.8) PER DART QSI 005 4.3 BLACK ANTI-SKID PAINT AS INDICATED PER DART QSI 005 4.4

 
ii) IT IS ACCEPTABLE TO GRIND A RELIEF IN THE D2855 AFT CAP TO PREVENT INTERFERENCE WITH THE SPACER AT THIS LOCATION

[illegible]

(MAKE FROM D2580-1 DRILLING DETAIL)

5.985
1.4
51.340
5.338 (REF)
39.580
5.915
3.630 (REF)
Ø0.508 (8 PLACES)
20.0
Ø0.640
11
1.0
DISTANCE BETWEEN HOLE AND TANGENT POINT
1.0
DISTANCE BETWEEN HOLE AND TANGENT POINT
32.0 ± 1.0
13.4
4
4

[illegible]

COPYRIGHT © 1998 BY DART AEROSPACE LTD. THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.	DESIGN	DRAWN BY	 DART AEROSPACE LTD. HAWKESBURY, ONTARIO, CANADA		
	CHECKED	APPROVED		DRAWING NO.	REV. D
	DATE	TITLE		SHEET 3 OF 3	SCALE
	07.02.27	205 SKIDTUBE ASSEMBLY			1:24

NO. 149

AWS D17.1.2001
QUALIFICATION TEST RECORD

Name: Barclay Elliot
Job number: 383073
Part number: D205 634 041
Description: skid tube 205
Welding Process: Tig ☒ Mig ☐
Base material: Aluminium
Current: AC ☒ DC ☐

TEST REQUIREMENTS AND RESULTS

Visual: pass ☒ fail ☐
Penetration: pass ☒ fail ☐

UNACCEPTABLE

Cracks: pass ☒ fail ☐
Undercut: pass ☒ fail ☐
Pin holes: pass ☒ fail ☐
Overlap (cold lap): pass ☒ fail ☐
Porosity (surface): pass ☒ fail ☐
Coloration: pass ☒ fail ☐

Qualifier Pat Duval Date of Test Coupon 08-04-18
Welder Barclay Elliot Date of Test Coupon 08-04-18

The above named individual is qualified in accordance with AWS D17.1.2001 to weld